


Heavy Duty Psychrometer + IR Thermometer

Model HD500

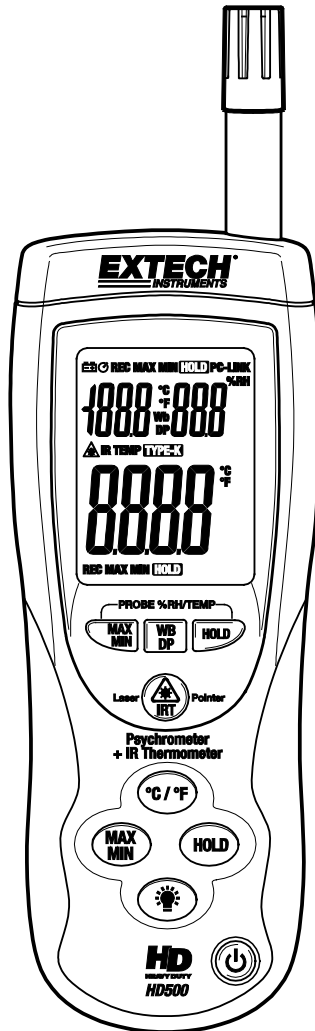

Introduction

Congratulations on your purchase of the Extech HD500 Psychrometer. This handheld meter measures and displays Air Temperature, Relative Humidity, Dew Point, Wet Bulb and also Surface Temperature using the built-in IR thermometer. This meter is shipped fully tested and calibrated and, with proper use, will provide years of reliable service.

Features

- Triple digital LCD display.
- Fast response, all data is calculated four times per second
- Standard type K (NiCr-NiAl) Thermocouple input jack suitable for any style of type K probe
- Infrared thermometer to measure surface temperature
- Red laser pointer included
- LCD with Backlight
- Automatic range selection
- USB interface
- Low battery indication
- Auto Power off


Safety

- Use extreme caution when the laser pointer beam is on
- Do not point the beam toward anyone's eye or allow the beam to strike the eye from a reflective surface
- Do not use the laser near explosive gases or in other potentially explosive areas



Meter Description


1. Humidity & Air Temperature Sensor
2. Type K Thermocouple input jack
3. Laser pointer beam
4. IR temperature sensor
5. USB Interface
6. LCD Display
7. Upper display HOLD button
8. Upper display Temp./Wet Bulb/Dew Point button
9. Upper display record Max/Min button
10. IR Measurement button
11. °F/°C units button
12. Lower display HOLD button
13. Lower display record Max/Min button
14. Backlight button
15. Power button

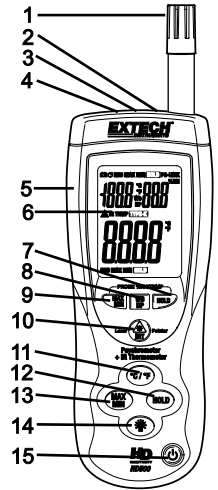

NOTE: Battery Compartment, Tilt Stand and Tripod Mount are located on the reverse side of the meter

Display Description

1. Low Battery icon
2. PC communication icon
3. Upper display function icons
4. Upper display
5. Laser pointer icon
6. Lower display function icons
7. Lower display
8. Lower display function icons

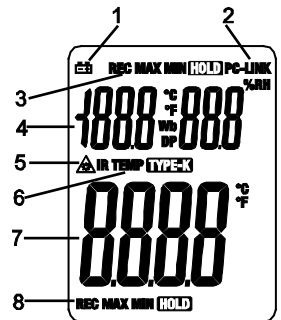

Operation

Basic Measurements

1. Press the **⏻** button to turn power on.
2. The upper display will indicate Air Temperature, Wet Bulb Temperature or Dew Point Temperature and % Relative Humidity.
Press the **WB/DP** button to toggle between Air, WB or DP.
3. The lower display will indicate Type K temperature or IR Temperature.
Press and hold the **IRT** button to select the IR Thermometer.
The TYPE-K function will display "-----" if a type k probe is not inserted into the meter.
4. Press the **°C/°F** button to change the temperature units from °C or °F.

Non-contact IR Surface Temperature Measurements

The built-in IR sensor can remotely measure the temperature of most surfaces. The Laser pointer allows the user to aim accurately when taking non-contact measurements.

1. Turn ON the meter using the **⏻** button.
2. The IR sensor and laser pointer are located at the top of the meter.
3. Point the sensor toward the surface to be measured.
4. Press and hold the **IRT** button to begin measuring the surface temperature of a desired target. **IR TEMP** and **▲** will appear on the display. The laser pointer will switch on to help aim the meter.
5. The measured IR surface temperature will appear on the lower display.
6. When the IRT button is released, the laser pointer will switch off and the reading will freeze (data hold) on the display for approximately 7 seconds.
7. After the 7 second hold time the meter returns to the type K mode.



WARNING: Do not directly view or direct the laser pointer at an eye. Low power visible lasers do not normally present a hazard, but may present some potential for hazard if viewed directly for extended periods of time.




Data Hold

1. Press the **HOLD** buttons (one for upper display and one for lower display) to freeze the displayed value for the respective display. Press again to unlock the display.
2. The **HOLD** icon will appear on the display when the Data Hold mode is active.

MIN-MAX Recording Mode

1. Press the **MAX/MIN** button (one for upper display and one for lower display) to begin recording the Maximum and Minimum reading. The **REC MAX** icon will appear and only the maximum value measured will appear in the display. The display will update only if a value higher than the currently displayed value is measured.
2. Press the **MAX/MIN** button again to display the minimum values. The **REC MIN** icon will appear and only the minimum recorded value will appear in the display.
3. Press the **MAX/MIN** button again to display the currently measured values. The **REC** icon will appear in the display and the Max and Min values will be stored in memory.
4. Press and Hold the **MAX/MIN** button for >2 seconds to exit the mode.


Backlight

Press the  backlight button to turn the backlight ON or OFF.

Note: continuous use of the backlight function will reduce battery life.

Auto-Power Off

The meter will automatically turn off after 15 minutes of operation if no buttons are pressed during this period. Auto-power off can be disabled by:

1. Hold the **IRT** button and then press the  button to turn the power on. When “disAPO” appears in the display, release the **IRT** button and the APO is disabled.

Low Battery

When the battery reaches the minimum operating voltage the battery icon will appear in the display. Replace the 9V battery when this happens.

Battery Replacement

When the battery icon appears on the LCD, the 9V battery must be replaced.

1. The battery compartment is located on the rear of the meter.
2. Press in and down on the arrow located above the tilt stand hinge.
3. Replace the 9V battery
4. Replace the battery cover.

Battery Safety Reminders

- Please dispose of batteries responsibly; observe local, state, and national regulations.
- Never dispose of batteries in a fire; batteries may explode or leak.
- Never mix battery types; install new batteries of the same type.

USB Interface and Software

This meter has the capability to connect to and communicate with a PC.

Check the software download page of the website www.extech.com/software for the latest version of the PC software and its operating system compatibility.

Download and unzip the software. Run ExtechInstaller.exe and then refer to the instructions provided in the HELP Utility within the software program.

InfraRed Measurement Considerations


- When taking IR measurements the meter automatically compensates for ambient temperature changes. Note that it may take up to 30 minutes to adjust to extremely wide ambient changes.
- Low temperature measurements quickly followed by high temperature measurements may require several minutes to stabilize as a result of the IR sensor cooling process.
- If the surface of the object under test is covered with frost, oil, grime, etc., clean before taking measurements.
- If an object's surface is highly reflective apply masking tape or flat black paint before measuring.
- Steam, dust, smoke, etc. can obstruct measurements.
- To find a hot spot, aim the meter outside the area of interest then scan across (in an up and down motion) until the hot spot is located.
- IR measurements cannot be made through glass.

IR Theory

IR thermometers measure the surface temperature of an object. The meter's optics sense emitted, reflected, & transmitted energy that is collected and focused onto the meter's detector. The meter's circuitry translates this information into an LCD reading.

IR Field of View

Ensure that the desired target is larger than the spot size. As the distance from an object increases, the spot size of the area measured by the meter becomes larger. The meter's field of view ratio is 30:1, meaning that if the meter is 30 inches (cm) from the target, the diameter (spot) of the object under test must be at least 1 inch (cm). Refer below to the field of view diagram.

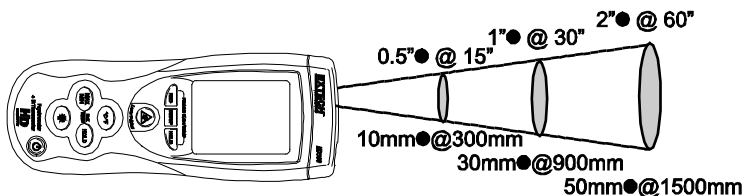

Emissivity

Most organic materials and painted or oxidized surfaces have an emissivity of 0.95. Inaccurate readings will result when measuring shiny or polished surfaces. To compensate, cover the surface under test with masking tape or flat black paint. Allow time for the tape to reach the same temperature as the material underneath then measure the temperature of the tape or the painted surface.

Specifications

General Specifications

Display	Dual Display Multi-function LCD with 9999 counts
Data Hold	Freezes displayed reading
Sampling rate	1 reading per second
Sensors	Relative Humidity: Capacitance, Air Temp: Thermistor
IR Distance to Spot ratio	30:1
IR Spectral response	6 to 14 μ m
IR Emissivity	0.95 fixed
MIN-MAX	Record and Recall lowest and highest readings
Auto Power OFF	Automatic shut off after 15 minutes (can be disabled)
PC Interface	USB PC Communication with supplied software and cable for data acquisition
Over range indication	Dashes appears on the LCD
Low battery indication	Battery symbol appears on the LCD
Power supply	9V Battery
Operating conditions	Meter: 32 to 122°F (0 to 50°C); 80% RH max.
Dimensions / Weight	Main instrument: 10.1 x 3.0 x 2" (257 x 76 x 53mm)
Weight	12.5 oz (355g)

Range Specifications

Function	Range	Resolution	Accuracy
Temp (type-K)	-148°F to -20°F	1 \geq 1000	\pm (3.0% reading + 4°F)
	-20°F to 2501°F		\pm (3.0% reading + 2°F)
	-100°C to -30°C	0.1 $^{\circ}$ <1000	\pm (3.0% reading + 2°C)
	-30°C to 1372°C		\pm (3.0% reading + 1°C)
IR Temp	-58 to -4°F -50 to -20°C	0.1°F/°C	\pm 9.0°F / 5.0°C
	-4 to 932°F -20 to 500°C	0.1°F/°C	\pm 2% reading or \pm 4°F/2°C
Air Temp.	-4 to 140°F -20 to 60°C	0.1°F/°C	\pm (2% reading + 2°F/1°C)
%RH	10% to 90%	0.1%RH	\pm 2% RH
	<10% and >90%	0.1%RH	\pm 3% RH
Wet Bulb	-6.88 to 140°F -21.6 to 60°C	0.1°F/°C	calculated
Dew Point	-90.4 to 140°F -68 to 60°C	0.1°F/°C	calculated

Thermal Emissivity Table for Common Materials

Material	Emissivity	Material	Emissivity
Asphalt	0.90 to 0.98	Cloth (black)	0.98
Concrete	0.94	Human skin	0.98
Cement	0.96	Leather	0.75 to 0.80
Sand	0.90	Charcoal (powder)	0.96
Earth	0.92 to 0.96	Lacquer	0.80 to 0.95
Water	0.67	Lacquer (matt)	0.97
Ice	0.96 to 0.98	Rubber (black)	0.94
Snow	0.83	Plastic	0.85 to 0.95
Glass	0.85 to 1.00	Timber	0.90
Ceramic	0.90 to 0.94	Paper	0.70 to 0.94
Marble	0.94	Chromium oxides	0.81
Plaster	0.80 to 0.90	Copper Oxides	0.78
Mortar	0.89 to 0.91	Iron Oxides	0.78 to 0.82
Brick	0.93 to 0.96	Textiles	0.90

Three-year Warranty

*Teledyne FLIR warrants this Extech brand instrument to be free of defects in parts and workmanship for **three years** from date of shipment (a six-month limited warranty applies to sensors and cables). To view the full warranty text please visit: <http://www.extech.com/support/warranties>.*

Calibration and Repair Services

Teledyne FLIR offers calibration and repair services for the Extech brand products we sell. We offer NIST traceable calibration for most of our products. Contact us for information on calibration and repair availability, refer to the contact information below. Annual calibrations should be performed to verify meter performance and accuracy. Product specifications are subject to change without notice. Please visit our website for the most up-to-date product information: www.extech.com.

Contact Customer Support

Customer Support Telephone List: <https://support.flir.com/contact>

Calibration, Repair, and Returns: repair@extech.com

Technical Support: <https://support.flir.com>

Copyright © 2022 Teledyne FLIR Commercial Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form
www.extech.com